



SERVICE BULLETIN



WORL DLAWN POWER EQUIPMENT, INC.
2415 Ashland Ave
Beatrice, NE 68310
(402) 228-4255

Bulletin Number: SB1403

Date: 1/20/14

Product Affected: ER52FX730V stand on mowers with serial numbers 60706 through 60847

Situation: During the first generation of product we found several areas of improvement. Not all of these issues will affect all customers and will be considered a fix as fails in the warranty period.

1. Potential for the fuel tank straps to work loose.
2. Potential for the rear deck idler arm to hit the exhaust when the deck is lifted up to the latched position.
3. Potential for the deck stop to contact before the height latches engage to hold the deck in the up position.
4. When the deck is in the lowest height of cut position the deck belt life was significantly reduced.

Solution: Should you have a unit exhibiting the conditions as noted above you may install the new components and receive warranty reimbursement.

- Parts Required:**
1. 452137 fuel tank strap kit (qty 1 per unit)
 2. 452067 idler arm with bearings (qty 1 per unit)
 3. 452085 LH deck height latch (qty 1 per unit)
452086 RH deck height latch (qty 1 per unit)
 4. 452116 rear height adjust pin weldment (qty 2 per unit)

Warranty: Warranty will cover the cost of the parts and labor to install them.