



# SERVICE BULLETIN

**Date:** 6/21/2002

**Number:** SB0205

**Subject:** Floating Idler Spring (part # 523327)

---

---

**Details:**

We have had some reports of floating idler spring failures on Prowler units. Please replace this spring with part # 593074 - Idler Spring HH. This spring will work on the clutch tensioner and also the deck tensioner.

When installing the new spring on the clutch tensioner, you must add one 5/16-18x1 1/4" HHCS (part # 100274) and two 5/16-18 Whizlock Nuts (part # 109001) to the tensioner arm to serve as a spring hook.

Please make note of this change in your service books and notify your dealers.

Thank you,  
Encore Service Department