



SERVICE BULLETIN

Date: November 27, 2002

Number: SB0213

Subject: Prowler Control Arms

Details:

Prowlers with the T-box style steering, serial #'s 41004 to 43650, may not have a steering lever "block" thus allowing premature wear to the control box assembly. This may be remedied by adding part # 583191 to the control box assy. or by simply replacing the complete handle bar (part # 592060, refer to drawing).



OPTION 1:

Install 1" plug (part # 583191) by pushing it into the control box assy. on the inside of the control arm.

OPTION 2:

The complete handle bar may be changed to upgrade to the new style by ordering part #592060 for a quantity of 2. Encore will allow .25 hrs per side if replacing the handle bar. The bar can be replaced through the bottom side of control box assy. by removing the retaining bolt, slide new handle bar into place and re-bolt control box assy.