



# SERVICE BULLETIN



WORLDLAWN POWER EQUIPMENT, INC.  
2415 Ashland Ave  
Beatrice, NE 68310  
(402) 228-4255

Bulletin Number: SB1404  
Date: 5/30/14

Product Affected: EC52FX730V3, EC52FX730V5, EC60FX730V3 & EC60FX801V5 mowers with serial numbers 61401 to 61420

Situation: We had several field complaints on units with low hours where the deck has bent under the stationary idler pulley. When the deck bends the idler pulley may tip or lean over. The resulting misalignment may cause the belt to come off.

Solution: A reinforcement plate was added to all units in production and in inventory. All units in distributor, dealer, and retailed inventory should be updated as soon as practical. A kit was developed which contains two reinforcement plates, one for each of the stationary idlers.

Parts Required: 542121 reinforcement kit  
One kit per unit.

Warranty: Warranty will cover the cost of the parts and labor to install them.

Important Note The large idler needs to be installed with the snap ring on top. The small idler needs to be installed with the snap ring on the bottom

