

# SERVICE BULLETIN

Date: 5/29/2003

Number: SB0305


Subject: Belt tensioner for deck drive belt on 52"/61" Midcut Prowler

**Details:** Relocating the tensioner spring and spring hook allows for more adjustment and clearance for the deck belt and tension idler pulley. By doing this, the front stationary idler should be positioned in the back mounting hole (there are two possible mounting positions). This will provide more clearance between the tension idler pulley and the side frame.

The new tensioner system is being applied to production units with serial # 45765 and above. Any 52"/61" Midcut Prowler can be retro-fitted with the new components to changeover their existing tensioner system to the new style. Order the following parts:

Part #	Qty	Description
107513	1	3/8-16 x 3 Carr.
823309	1	Frame Spacer
109007	1	3/8-16 Whizlock Nut
107500	1	3/8-16 x 2-1/2 Carr.
593126	1	Idler Tension Angle

Below is the diagram showing the installation for the new deck tensioner system:

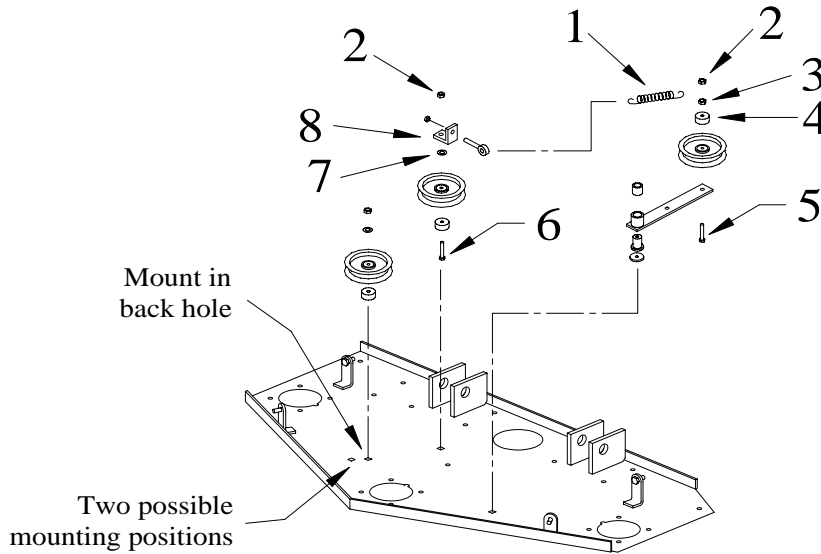

## Parts List

#	Part #	Description
1	593074	Idler Spring
2	104257	3/8-16 Nyloc Nut
3	109007	3/8-16 Whizlock Nut
4	823309	Frame Spacer
5	107513	3/8-16 x 3 Carr.
6	107500	3/8-16 x 2-1/2 Carr.
7	105260	3/8 Flatwasher
8	593126	Idler Tension Angle