




SERVICE BULLETIN

Date: 1/15/2003

Number: SB0301

Subject: New Brake Rod Assy

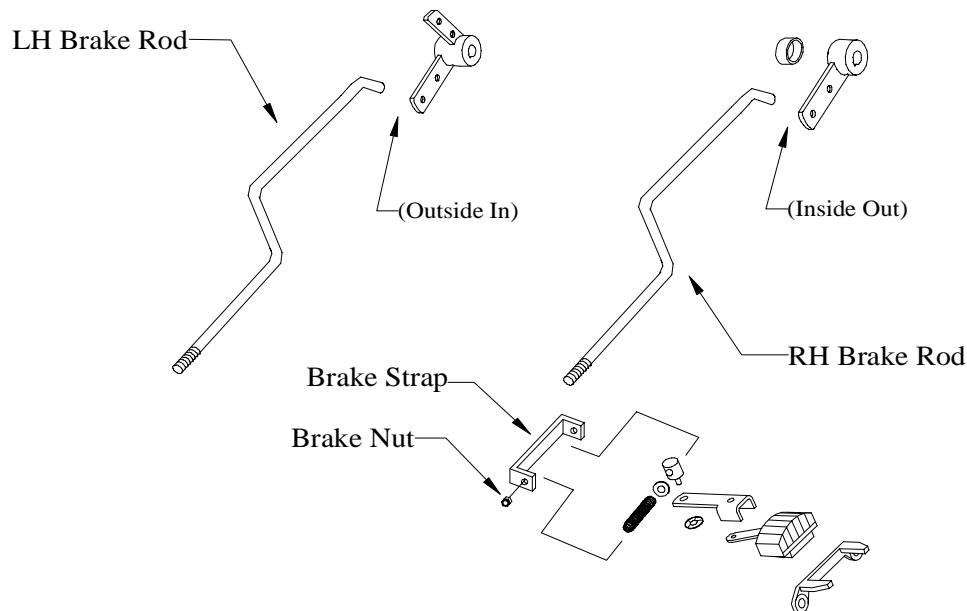

Details:

The above diagram displays the new Brake Rod Assy now being installed on the Prowler Series Riders. The Brake Strap and Brake Nut replace the 5/16" nyloc nut and the 5/16" clamp collar (part # 523112). The 5/16" flat washer is replaced by a 5/16" SAE Washer (part # 105257). Note that the 5/16" SAE Washer is now located **between** the brake spring (part # 523024) and the park brake swivel (part # 423130).

Existing brake rod assy's may be retro-fitted with the new assy design. This replacement may be performed by purchasing the following components:

Part #	Qty	Description
593114	2	Brake Spring Strap
593116	2	Brake Spring Nut
105257	2	5/16" SAE Washer
363177	2	3/8" Push Nut

*** When performing this changeover, it is recommended that the brake rod assy be removed from the machine by removing the 3/8" push nut from the park brake swivel and disconnecting the brake rod from the brake crank (note the direction the brake rod connects to the brake crank as shown in diagram) and re-assembling with new components before re-installing onto machine.